Cookies on Check the MOT history of a vehicle service

We use some essential cookies to make this service work.

We'd like to set additional cookies so we can remember your settings, understand how people use the service and make improvements.

Accept additional cookies Reject additional cookies View cookies

GOV·UK

Check the MOT history of a vehicle

Help us make this service better. Give us your feedback.

< Back

[redacted]

CITROEN C3

Check another vehicle

Colour	Fuel type	Date registered
Silver	**Petrol**	**21 March 2003**

MOT valid until

13 October 2027

Get an MOT reminder by email or text.

Download test certificates

You can get information corrected on your MOT history (such as mileage or vehicle details) if it's wrong.

Hide all sections

MOT history

Check mileage recorded at test, expiry date, and test outcome

Hide

Date tested
14 October 2026
PASS

Mileage
143,556 miles

MOT test number
8391 0829 3780

Test location
▶ View test location

Expiry date
13 October 2027

Monitor and repair if necessary (advisories):
- **Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))**

▶ What are advisories?

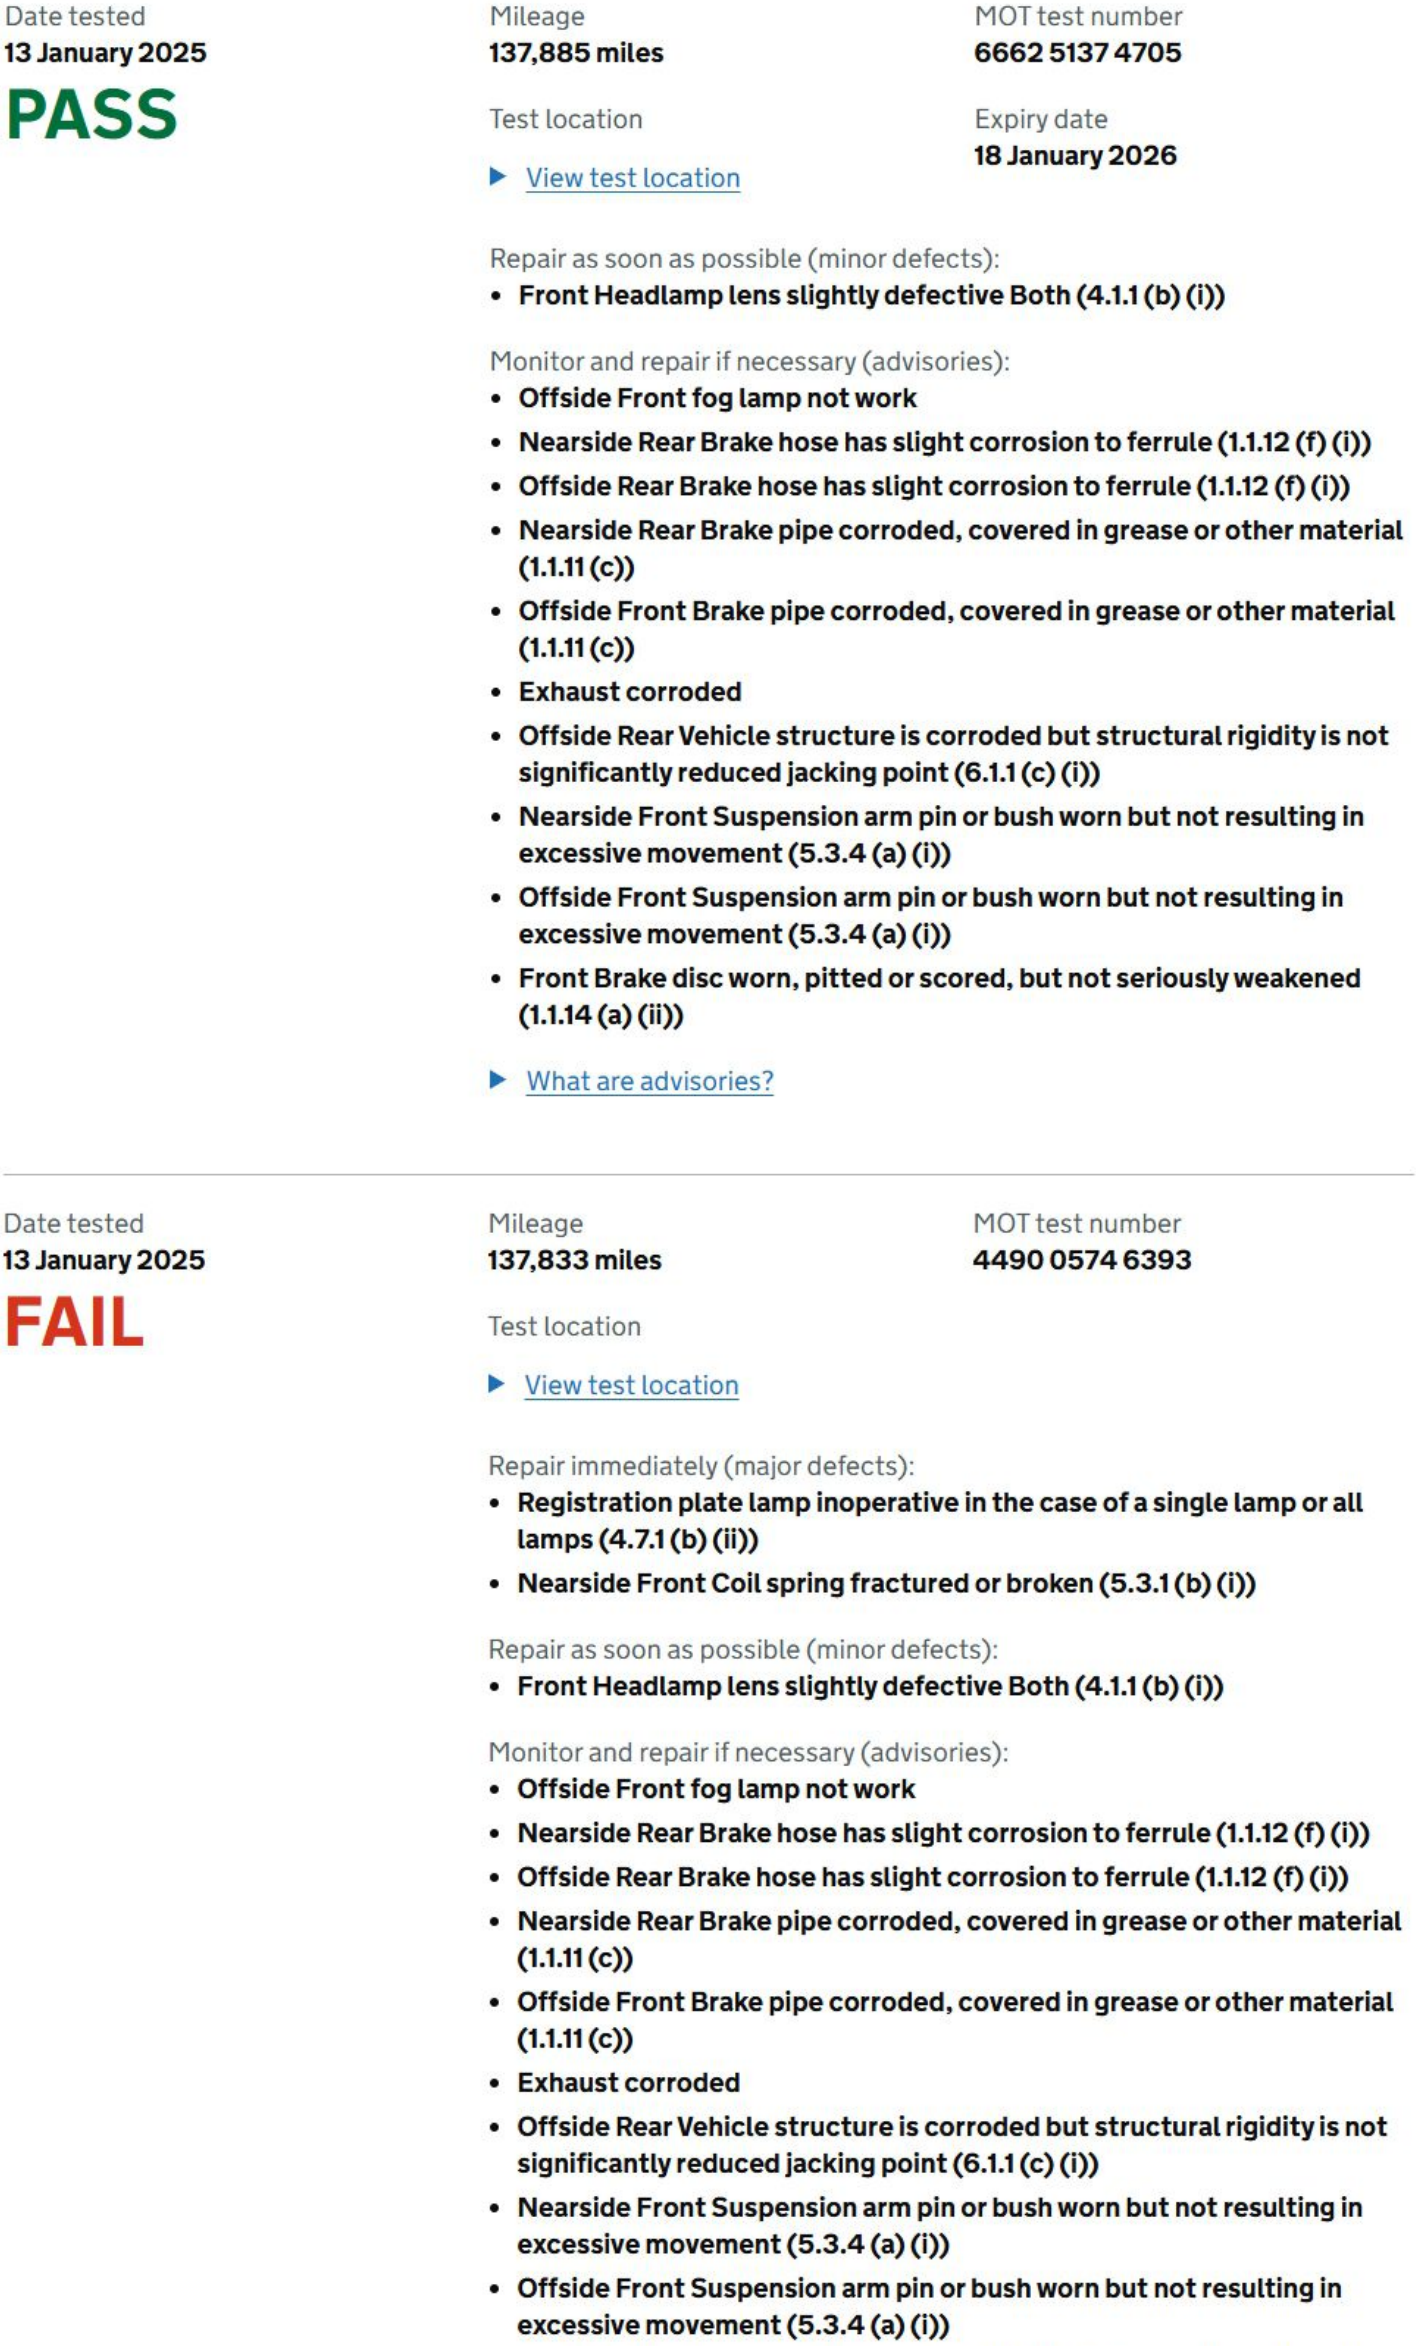

Date tested
13 January 2025

PASS

Mileage
137,885 miles

MOT test number
6662 5137 4705

Test location

▶ View test location

Expiry date
18 January 2026

Repair as soon as possible (minor defects):

- **Front Headlamp lens slightly defective Both (4.1.1 (b) (i))**

Monitor and repair if necessary (advisories):

- **Offside Front fog lamp not work**
- **Nearside Rear Brake hose has slight corrosion to ferrule (1.1.12 (f) (i))**
- **Offside Rear Brake hose has slight corrosion to ferrule (1.1.12 (f) (i))**
- **Nearside Rear Brake pipe corroded, covered in grease or other material (1.1.11 (c))**
- **Offside Front Brake pipe corroded, covered in grease or other material (1.1.11 (c))**
- **Exhaust corroded**
- **Offside Rear Vehicle structure is corroded but structural rigidity is not significantly reduced jacking point (6.1.1 (c) (i))**
- **Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))**
- **Offside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))**
- **Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))**

▶ What are advisories?

Date tested
13 January 2025

FAIL

Mileage
137,833 miles

MOT test number
4490 0574 6393

Test location

▶ View test location

Repair immediately (major defects):

- **Registration plate lamp inoperative in the case of a single lamp or all lamps (4.7.1 (b) (ii))**
- **Nearside Front Coil spring fractured or broken (5.3.1 (b) (i))**

Repair as soon as possible (minor defects):

- **Front Headlamp lens slightly defective Both (4.1.1 (b) (i))**

Monitor and repair if necessary (advisories):

- **Offside Front fog lamp not work**
- **Nearside Rear Brake hose has slight corrosion to ferrule (1.1.12 (f) (i))**
- **Offside Rear Brake hose has slight corrosion to ferrule (1.1.12 (f) (i))**
- **Nearside Rear Brake pipe corroded, covered in grease or other material (1.1.11 (c))**
- **Offside Front Brake pipe corroded, covered in grease or other material (1.1.11 (c))**
- **Exhaust corroded**
- **Offside Rear Vehicle structure is corroded but structural rigidity is not significantly reduced jacking point (6.1.1 (c) (i))**
- **Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))**
- **Offside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))**

- **Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))**

▶ What are defects and advisories?

Date tested
19 January 2024

PASS

Mileage
120,677 miles

MOT test number
2119 0999 5643

Test location

▶ View test location

Expiry date
18 January 2025

Repair as soon as possible (minor defects):

- **Offside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))**
- **Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))**

Monitor and repair if necessary (advisories):

- **Offside Front fog lamp not working**
- **Offside Rear Shock absorbers has light misting of oil (5.3.2 (b))**
- **Offside Front Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))**
- **Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))**

▶ What are advisories?

Date tested
15 January 2024

FAIL

Mileage
120,670 miles

MOT test number
7611 4618 3014

Test location

▶ View test location

Repair immediately (major defects):

- **Nearside Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))**
- **Offside Headlamp has a product on the lens so that the light output is severely reduced cloudy and has condensation (4.1.4 (b))**
- **Nearside Headlamp has a product on the lens so that the light output is severely reduced cloudy (4.1.4 (b))**
- **Nearside Rear Seat belt retracting mechanism defective (7.1.2 (e))**
- **Nearside Rear Shock absorbers has a serious fluid leak (5.3.2 (b))**
- **Offside Rear Suspension component mounting prescribed area excessively corroded significantly reducing structural strength outer sill corroded within a suspension mount (5.3.6 (a) (i))**

Repair as soon as possible (minor defects):

- **Offside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))**
- **Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))**

Monitor and repair if necessary (advisories):

- **Offside Front fog lamp not working**
- **Offside Rear Shock absorbers has light misting of oil (5.3.2 (b))**
- **Offside Front Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))**
- **Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))**

▶ What are defects and advisories?

Date tested
4 January 2024
FAIL

Mileage
120,562 miles

MOT test number
5782 2560 3150

Test location

▶ View test location

Repair immediately (major defects):
- **Nearside Rear Seat belt not functioning as intended Not retracting. (7.1.2 (c))**
- **Nearside Rear Shock absorbers has a serious fluid leak (5.3.2 (b))**

Repair as soon as possible (minor defects):
- **Offside Rear Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))**
- **Offside Front Headlamp lens slightly defective Hazing. Slightly reducing light intensity. (4.1.1 (b) (i))**
- **Nearside Front Windscreen wiper blade defective Split (3.4 (b) (i))**

Monitor and repair if necessary (advisories):
- **Nearside Rear Vehicle structure is corroded but structural rigidity is not significantly reduced Outer sill has corroded and has a hole. (6.1.1 (c) (i))**

▶ What are defects and advisories?

Date tested
31 December 2022
PASS

Mileage
109,827 miles

MOT test number
2172 4810 2137

Test location

▶ View test location

Expiry date
6 January 2024

Repair as soon as possible (minor defects):
- **Offside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))**

Monitor and repair if necessary (advisories):
- **Headlamp has a product on the lens but not seriously reducing light output both (4.1.4 (b))**
- **Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))**
- **Nearside Rear Shock absorbers has light misting of oil (5.3.2 (b))**
- **dipstick broken**

▶ What are advisories?

Date tested
22 December 2021
PASS

Mileage
100,589 miles

MOT test number
8533 1499 5713

Test location

▶ View test location

Expiry date
6 January 2023

Monitor and repair if necessary (advisories):
- **Front Brake disc worn, but not excessively (1.1.14 (a) (i))**

▶ What are advisories?

Date tested
20 December 2021

FAIL

Mileage
100,589 miles

MOT test number
3930 5353 1008

Test location

▶ View test location

Do not drive until repaired (dangerous defects):

- **Nearside Rear Tyre tread depth below requirements of 1.6mm (5.2.3 (e))**

Repair immediately (major defects):

- **Nearside Front Position lamp not working (4.2.1 (a) (ii))**
- **Offside Front Coil spring fractured or broken (5.3.1 (b) (i))**
- **Offside Rear Wheel bearing rough when rotated (5.1.3 (b) (i))**

Monitor and repair if necessary (advisories):

- **Front Brake disc worn, but not excessively (1.1.14 (a) (i))**

▶ What are defects and advisories?

Date tested
22 December 2020

PASS

Mileage
91,076 miles

MOT test number
8972 2767 0143

Test location

▶ View test location

Expiry date
6 January 2022

Monitor and repair if necessary (advisories):

- **Offside Front fog lamp out but doesnt affect cars made before march 2018**
- **Nearside Rear Tyre worn close to legal limit/worn on edge 4mm (5.2.3 (e))**
- **Offside Rear Tyre worn close to legal limit/worn on edge 4mm (5.2.3 (e))**
- **Front Inner Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))**

▶ What are advisories?

Date tested
7 January 2020

PASS

Mileage
85,704 miles

MOT test number
3761 1329 4796

Test location

▶ View test location

Expiry date
6 January 2021

Monitor and repair if necessary (advisories):

- **O/S/F Fog light not working.**
- **Rear Shock absorbers light misting of oil or has limited damping effect both sides (5.3.2 (b))**
- **Offside Front Tyre worn close to legal limit/worn on edge 3mm and cracked (5.2.3 (e))**
- **Offside Rear Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))**
- **Nearside Rear Mudguard insecure**
- **Offside Rear Suspension spring mounting prescribed area is corroded but not considered excessive (5.3.6 (a) (i))**

▶ What are advisories?

Date tested
20 February 2019

PASS

Mileage
81,882 miles

Test location

▶ View test location

MOT test number
3328 7780 3274

Expiry date
26 February 2020

Monitor and repair if necessary (advisories):

- **Offside Front Tyre worn close to legal limit/worn on edge 3mm (5.2.3 (e))**
- **Play in steering rack inner joint(s)**

▶ What are advisories?

Date tested
20 February 2019

FAIL

Mileage
81,882 miles

Test location

▶ View test location

MOT test number
4430 4674 4097

Repair immediately (major defects):

- **Front Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))**

Monitor and repair if necessary (advisories):

- **Offside Front Tyre worn close to legal limit/worn on edge 3mm (5.2.3 (e))**
- **Play in steering rack inner joint(s)**

▶ What are defects and advisories?

> **The MOT test changed on 20 May 2018**
>
> Defects are now categorised according to their severity - dangerous, major, and minor. Find out more.

Date tested
13 February 2018

PASS

Mileage
75,572 miles

Test location

▶ View test location

MOT test number
1324 1112 9284

Expiry date
26 February 2019

Advisory notice item(s)

- **Play in steering rack inner joint(s)**

▶ What are advisories?

Date tested
16 February 2017

PASS

Mileage
69,023 miles

Test location

▶ View test location

MOT test number
7990 5194 2633

Expiry date
26 February 2018

Advisory notice item(s)

- **Nearside Rear Shock absorber has a light misting of oil (2.7.3)**
- **Offside Rear Shock absorber has a light misting of oil (2.7.3)**
- **Offside Rear Upper Suspension spring mounting prescribed area is corroded but not considered excessive (2.4.A.3)**

▶ What are advisories?

Date tested
12 February 2016

PASS

Mileage
63,927 miles

Test location

▶ View test location

MOT test number
9340 3442 1639

Expiry date
26 February 2017

Advisory notice item(s)

- **Nearside Rear Shock absorber has a light misting of oil (2.7.3)**
- **Offside Rear Shock absorber has a light misting of oil (2.7.3)**
- **Rear Exhaust has a minor leak of exhaust gases (7.1.2)**
- **centre and rear exhaust boxes corroded.**

▶ What are advisories?

Date tested
11 February 2016

FAIL

Mileage
63,927 miles

Test location

▶ View test location

MOT test number
8338 6894 9150

Reason(s) for failure

- **Nearside Rear Tyre has a cut in excess of the requirements deep enough to reach the ply or cords (4.1.D.1a)**

Advisory notice item(s)

- **Nearside Rear Shock absorber has a light misting of oil (2.7.3)**
- **Offside Rear Shock absorber has a light misting of oil (2.7.3)**
- **Rear Exhaust has a minor leak of exhaust gases (7.1.2)**
- **centre and rear exhaust boxes corroded.**

▶ What are failures and advisories?

Date tested
19 February 2015

PASS

Mileage
58,805 miles

Test location

▶ View test location

MOT test number
4790 0085 5033

Expiry date
26 February 2016

Advisory notice item(s)

- **corrosion on exhaust silencers**

▶ What are advisories?

Date tested
21 February 2014

Mileage
54,417 miles

MOT test number
2591 6275 4029

PASS

Test location

▶ View test location

Expiry date
26 February 2015

Advisory notice item(s)
- **corrosion on rear exhaust silencer**

▶ What are advisories?

Date tested
20 February 2014

FAIL

Mileage
54,417 miles

MOT test number
4878 1185 4017

Test location

▶ View test location

Reason(s) for failure
- **Nearside Rear coil spring broken (2.4.C.1a)**

Advisory notice item(s)
- **corrosion on offside rear coil spring**
- **both rear suspension bump stops missing**
- **corrosion on rear exhaust silencer**

▶ What are failures and advisories?

Date tested
14 February 2013

PASS

Mileage
49,279 miles

MOT test number
8454 0514 3008

Test location

▶ View test location

Expiry date
26 February 2014

Advisory notice item(s)
- **Nearside Rear coil spring corroded (2.4.C.1b)**
- **n/s/r suspension bump stop missing**
- **rear exhaust box corroded**

▶ What are advisories?

Date tested
9 February 2012

PASS

Mileage
44,508 miles

MOT test number
4969 9084 2014

Test location

▶ View test location

Expiry date
26 February 2013

Advisory notice item(s)
- **rear exhaust box corroded**

▶ What are advisories?

Date tested
17 February 2011

PASS

Mileage
39,787 miles

MOT test number
9288 5844 1094

Test location

▶ View test location

Expiry date
26 February 2012

Advisory notice item(s)

- **Rear Exhaust has part of the system slightly deteriorated (7.1.1a)**

▶ What are advisories?

Date tested
17 February 2010

PASS

Mileage
34,585 miles

MOT test number
8523 7804 0089

Test location

▶ View test location

Expiry date
26 February 2011

Advisory notice item(s)

- **Rear Exhaust has part of the system slightly deteriorated (7.1.1a)**
- **Offside Front Tyre worn close to the legal limit (4.1.E.1)**

▶ What are advisories?

Date tested
11 February 2010

FAIL

Mileage
34,479 miles

MOT test number
8510 4244 0022

Test location

▶ View test location

Reason(s) for failure

- **Offside Front coil spring fractured (2.4.C.1a)**

Advisory notice item(s)

- **Rear Exhaust has part of the system slightly deteriorated (7.1.1a)**
- **Offside Front Tyre worn close to the legal limit (4.1.E.1)**

▶ What are failures and advisories?

Date tested
19 February 2009

PASS

Mileage
29,050 miles

MOT test number
1821 7095 9037

Test location

▶ View test location

Expiry date
26 February 2010

Advisory notice item(s)

- **corrosion on rear exhaust silencer**

▶ What are advisories?

Date tested
21 February 2008

PASS

Mileage
23,871 miles

MOT test number
6218 1235 8091

Test location

▶ View test location

Expiry date
26 February 2009

Advisory notice item(s)

- **Front Exhaust has part of the system slightly deteriorated (7.1.1a)**
- **front wiper blades split slightly**

▶ What are advisories?

Date tested

27 February 2007

PASS

Mileage

18,605 miles

Test location

▶ View test location

Advisory notice item(s)

- **Exhaust has part of the system slightly deteriorated (7.1.1a)**
- **Nearside Front Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)**
- **slight binding front brakes**

▶ What are advisories?

MOT test number

1123 7885 7000

Expiry date

26 February 2008

Date tested

17 February 2006

PASS

Mileage

14,721 miles

Test location

▶ View test location

MOT test number

4832 4814 6033

Expiry date

16 February 2007

Safety recalls

> We do not have recall information for this vehicle.

Contact your local CITROEN dealership to check if the vehicle has been recalled.

Built by the Driver & Vehicle Standards Agency

OGL All content is available under the Open Government Licence v3.0, except where otherwise stated

© Crown copyright